



Belvac Production Machinery Technical Bulletin


Information for Customers Operating & Maintaining Belvac Machines

ISSUE 6, VOLUME 12, JUNE 2009

CC93/CC95 Trimmer Rotary Union Replacement

Belvac had used Talco Rotary Union C30405 for many years on all our CC trimmer series. Due to recent quality issues with the Talco unit that could not be resolved to our high standards, Belvac partnered with Rotary Systems to develop a unique and robust rotary union specific to Belvac's application. A Carbon Steel Construction with Hardened Shaft, Dual Sealed ball bearings, and Teflon seals make the new rotary union distinctive and durable. It has been successfully tested and implemented on all new Belvac CC Trimmers since April 2008. The new union has a new Belvac part number **C10123** and is a direct replacement to the Talco on the shaft.

The new rotary union has a slightly larger body size than the part it replaces. Please note when installing for the first time, it is possible that the motor mounting plate requires a small cut-out to allow clearance of the new rotary union. (See pictures below). Belvac no longer supplies the Talco rotary union (Belvac part number C30405). If the C30405 part number is ordered, you will automatically receive the new rotary union part number **C10123**.

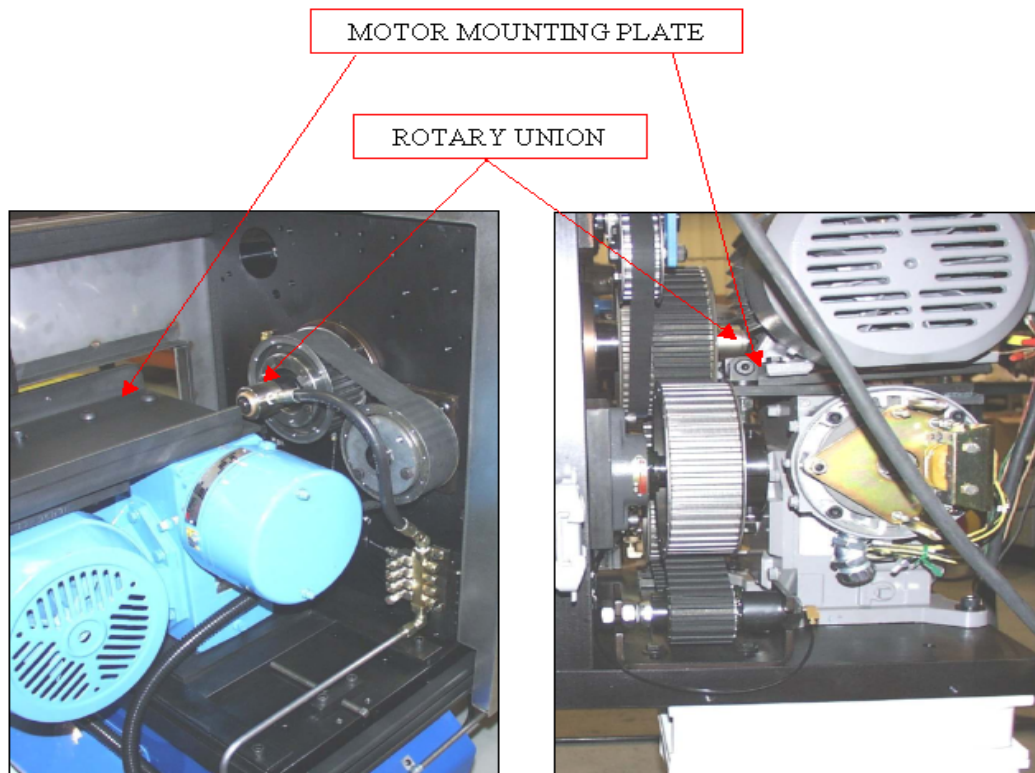

CC93RL DRIVE

CC93CL DRIVE